


Thunderbolt 5/USB4 Dock, Triple Display, 8x USB, NVMe Slot, 5GbE, 140W PD


Product ID

183N-TB5USB4DOCK
183UE-TB5USB4DOCK


Top View

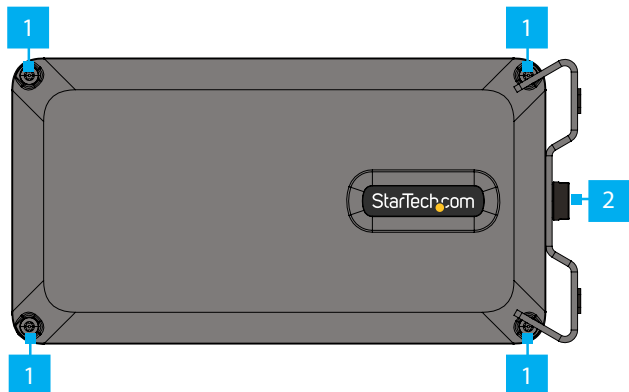

Front View

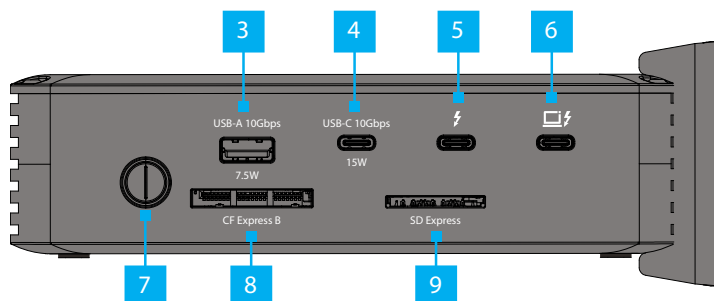

Rear View

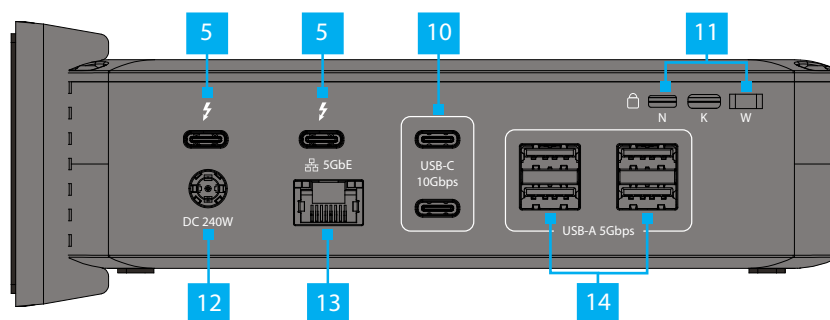

*Product may vary from image

Component		Function
1	Lid Screws	- Secures the Lid to the Docking Station - Remove to access the PCIe 4.0 x4 NVMe SSD Slot
2	Thumb Screw	Secures the Standing Base to the Docking Station
3	USB-A 10Gbps Port	- Connect and/or charge a USB Peripheral - Supports up to 7.5W Battery Charging (BC) 1.2
4	USB-C 10Gbps Port	- Connect and/or charge a USB Peripheral - Supports up to 15W
5	Thunderbolt 5 Port	Connect a Thunderbolt Device, USB Device, or Display
6	Thunderbolt 5 Host Connection	- Connect to a Thunderbolt 5 Port on the Host Computer - Supports Power Delivery 3.1 for up to 140W Laptop Charging
7	Power Button	Press and release to toggle Power on or off for the Docking Station
8	CFexpress Card Slot	- Insert a CFexpress Card - Supports CFexpress 2.0 Type B
9	SD Express Card Slot	- Insert a SD Express Card or microSD Card with an Adapter (not included) - Supports SD Express 7.1
10	USB-C 10Gbps Ports	Connect and/or charge a USB Peripheral
11	3x Lock Slots (Nano/Standard/Wedge)	Connect a K-Slot, Nano, or Wedge Locking Device to deter theft of the Docking Station
12	Power Input	Connect the Docking Station to a Power Source using the included Universal Power Adapter
13	5Gbps Ethernet Port	- Connect the Docking Station to a Network - Supports 5GBASE-T
14	USB-A 5Gbps Port	- Connect and/or charge USB Peripherals - Supports up to 4.5W

Package Contents

- Thunderbolt 5 Docking Station x 1
- Thunderbolt 5 Host Cable x 1
- T10 Security Screwdriver x 1
- Universal Power Adapter x 1
- Product Documentation x 1

Requirements

For the latest manuals, product information, technical specifications, and declarations of conformance, please visit: www.StarTech.com/183N-TB5USB4DOCK or www.StarTech.com/183UE-TB5USB4DOCK

- This Docking Station can function with Thunderbolt 5, Thunderbolt 4, or USB4 host ports.
- Video support and performance, such as the number of external displays, their resolution, and refresh rate, depend on the host computer and the performance of the video card or host port.

Installation

(Optional) Install an NVMe Drive

Note: The NVMe drive slot only supports 2280-size NVMe drives.

Ensure that the docking station is physically disconnected from the power source before installing the NVMe drive.

1. If the **Docking Station Stand** is installed, loosen the **Thumb Screw** to remove the **Docking Station Stand**.
2. Using the included **T10 Security Screwdriver**, remove the four **Lid Screws** from the top of the **Docking Station**.
3. Remove the **Lid** to access the **NVMe Slot**.
4. Ensure the **NVMe Drive Latch** is in the unlocked position.
5. Gently slide the **M.2 Drive Connector** into the **NVMe Slot**, then press the **Drive** down toward the slot until it is properly seated.
6. Turn the **NVMe Drive Latch** to the locked position to secure the **NVMe Drive** in place.
7. Reinstall the **Docking Station Lid** that was removed in **Step 3**.
8. Using the included **T10 Security Screwdriver**, reinstall the **Lid Screws** that were removed in **Step 2**.
9. Align the **Docking Station Stand** with the side of the **Docking Station**, and re-install the **Thumb Screw** that was removed in **Step 1**.

Note: The vertical orientation provided by the stand improves air convection and allows for improved thermal performance; utilizing the stand while an M.2 NVMe drive is installed is highly recommended to achieve cooler operation.

Install the Docking Station

1. Connect the **Power Adapter** from an **AC Outlet**, to the **Power Input Port** on the **Docking Station**.
2. Connect a **Network Cable** from a **Network Port/Device** to the **5Gbps Ethernet Port** on the back of the **Docking Station**.
3. Connect **USB Devices** or **Peripherals** to the **USB-A** and **USB-C Ports** located on the front and rear of the **Docking Station**.
4. (Optional) Connect up to three **Thunderbolt** or **USB Devices** to the **Thunderbolt 5 Ports**.
or
Connect up to three **USB-C Cables** or **Video Adapters** (sold separately) to the **Thunderbolt 5 Ports**.
5. (Optional) Insert a **CFexpress Card** into the **CFexpress Card Slot**.
Note: To remove the CFexpress Card, push in the card and then pull out the CFexpress Card.
6. (Optional) Insert a **SD Express Card** into the **SD Express Card Slot**.
Note: To remove the SD Card, push in the card and then pull out the SD Card.
Standard SD Express cards will operate in UHS-I mode.
7. Connect the included **Thunderbolt 5 Host Cable** from the **Thunderbolt 5 Host Connection** on the back of the **Docking Station** to a **Thunderbolt 5 Port** on the **Laptop**.
8. Press the **Power Button** on the front to power on the **Docking Station**.
9. The **Host Computer** will automatically detect the **Docking Station** and install the required **Drivers**.

HQ Contact:

StarTech.com Ltd.
45 Artisans Crescent,
London, ON N5V 5E9,
Canada

US Contact:

StarTech.com USA LLP
4490 South Hamilton Rd,
Groveport, OH 43125,
United States

UK Contact:

StarTech.com Ltd.
15 Gowerton Rd,
Northampton, NN4 7BW,
United Kingdom

EU Contact:

StarTech.com Ltd.
Siriusdreef 17-27
2132 WT Hoofddorp
The Netherlands

JP Contact:

StarTech.com K.K.
Atelier Yours Ogawamachi 7F
1-10-2 Kanda Ogawamachi
Chiyoda-ku, Tokyo 101-0052
Japan

FR: startech.com/fr
DE: startech.com/de
ES: startech.com/es
NL: startech.com/nl
IT: startech.com/it
JP: startech.com/jp

